

**PIC24FJ256GA412/GB412 Family
Silicon Errata and Data Sheet Clarification**

The PIC24FJ256GA412/GB412 family devices that you have received conform functionally to the current Device Data Sheet (DS30010089D), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the PIC24FJ256GA412/GB412 family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A2**).

Data Sheet clarifications and corrections start on [page 8](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip’s programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. Based on the version of MPLAB IDE you are using, do one of the following:
 - a) For MPLAB IDE 8, select *Programmer > Reconnect*.
 - b) For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon ().
5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC24FJ256GA412/GB412 family silicon revisions are shown in [Table 1](#).

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾	Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾
		A2			A2
PIC24FJ256GA412	6112h	0010h	PIC24FJ256GB412	6116h	0010h
PIC24FJ128GA412	610Ah		PIC24FJ128GB412	610Eh	
PIC24FJ64GA412	6102h		PIC24FJ64GB412	6106h	
PIC24FJ256GA410	6111h		PIC24FJ256GB410	6115h	
PIC24FJ128GA410	6109h		PIC24FJ128GB410	610Dh	
PIC24FJ64GA410	6101h		PIC24FJ64GB410	6105h	
PIC24FJ256GA406	6110h		PIC24FJ256GB406	6114h	
PIC24FJ128GA406	6108h		PIC24FJ128GB406	610Ch	
PIC24FJ64GA406	6100h		PIC24FJ64GB406	6104h	

- Note 1:** The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format, “DEVID DEVREV”.
- 2:** Refer to the “*PIC24FJ256GA412/GB412 Family Flash Programming Specification*” (DS30010073) for detailed information on Device and Revision IDs for your specific device.

PIC24FJ256GA412/GB412 FAMILY

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions ⁽¹⁾
				A2
POR/BOR	Reset	1.	If the Brown-out Reset (BOR) is disabled, the part may fail to come out of the Reset state during the VDD power-down and the subsequent power-up condition.	X
POR/BOR	Reset	2.	If the Brown-out Reset (BOR) is disabled, the part may not start at the minimum VDD specification.	X
POR/BOR	Reset	3.	The POR bit may get set at temperatures below 0°C when BOR occurs.	X
Reset	Trap Conflict	4.	The TRAPR bit is not getting set when a hard trap conflict occurs.	X
I ² C	Slave Mode	5.	While AHEN = 1, a slave interrupt may be asserted after an address mismatch if the data byte matches the device slave address.	X
I ² C	Slave Mode	6.	In 10-Bit Addressing Slave mode, on receiving the upper address byte (A9 and A8 bits), the Acknowledge Time Status bit (ACKTIM) is not asserted during the Acknowledgment sequence.	X
MCCP/SCCP (Output Compare)	Single Edge Event	7.	The Single Edge Compare Event Status (SCEVT) bit is not setting for MOD<3:0> = 0010.	X
SPI	Slave Mode	8.	In Slave mode, the RX watermark interrupt does not wake the device from Sleep, which causes loss of the first few receive bytes.	X
SPI	Audio PCM/DSP	9.	SPI module follows Right Justified mode of transmission and reception in PCM/DSP mode.	X
SPI	Slave Mode Audio L/R Justified	10.	In Slave mode, the Most Significant bit (MSb) is missed in Left and Right Justified modes.	X
SPI	Slave Mode Audio L/R Justified	11.	At start-up, the Idle state of the SDOx pin will be the same as the Most Significant bit of the first data packet loaded when in Slave mode and configured for Left Justified or Right Justified mode.	X
SPI	Master Mode	12.	While operating in Master mode (MSTEN = 1), the transmit watermark interrupt is not asserted if there is more than one entry in the FIFO buffer.	X
Primary XT and HS Oscillator (POSC)	Primary Oscillator Start-up Timer (OST)	13.	The OST may indicate the oscillator is ready for use too early.	X

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

PIC24FJ256GA412/GB412 FAMILY

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A2**).

1. Module: POR/BOR

If Brown-out Reset (BOR) is disabled, the part may fail to come out of the Reset state during the VDD power-down and the subsequent power-up condition.

When BOR is disabled, in extremely rare cases, the part remains in the Reset state during the VDD power-down (not until VSS), followed by the subsequent power-up condition.

Work around

There are three known work arounds for this issue:

- Always enable BOR by setting the Configuration Fuse bit, BOREN (FPOR<0>) = 1.
- Use an external voltage supervisor chip on the $\overline{\text{MCLR}}$ pin to hold the $\overline{\text{MCLR}}$ low when the power supply voltage is between 1.4V and 2.0V. Release $\overline{\text{MCLR}}$ after the VDD is in the operating range.
- Make sure that VDD goes all the way to VSS before powering on.

Affected Silicon Revisions

A2								
X								

2. Module: POR/BOR

When BOR is disabled, the part may not start at the minimum VDD specification.

Work around

There are two known work arounds for this issue:

- Always enable BOR by setting the Configuration Fuse bit, BOREN (FPOR<0>) = 1.
- For initial start-up, make sure that the minimum VDD is more than 2.2V. Once the device is powered, it will operate down to the minimum VDD voltage specified in the data sheet specifications. This is a typical battery-operated application with a fully charged battery installed into the application. The part will continue to operate to the data sheet specifications.

Affected Silicon Revisions

A2								
X								

3. Module: POR/BOR

The POR Reset flag bit (RCON<0>) may get set in addition to the BOR Reset flag bit (RCON<1>) when a BOR Reset occurs at temperatures below 0°C.

Work around

None.

Affected Silicon Revisions

A2								
X								

4. Module: Reset

If a lower priority address error trap occurs while a higher priority oscillator failure trap is being processed, the TRAPR bit, (RCON<15>), is not set. A Trap Conflict Reset does not occur as expected and the device may stop executing code.

Work around

None. However, a $\overline{\text{MCLR}}$ /POR Reset will recover the device.

Affected Silicon Revisions

A2								
X								

PIC24FJ256GA412/GB412 FAMILY

5. Module: I²C

When the device is operating as an I²C slave with multiple slaves on the I²C bus, and if the master is communicating with another slave and a transmitted data byte matches the slave address of the device, the device may generate an unexpected slave interrupt.

Work around

User application should ignore the extra interrupt until a Stop condition is seen on the data bus.

Affected Silicon Revisions

A2								
X								

6. Module: I²C

In I²C Slave 10-Bit Addressing mode, on receiving the upper address byte (A9 and A8 bits), the Acknowledge Time Status (ACKTIM) bit (I2CxSTAT<13>) is not asserted during an Acknowledgment sequence.

The issue is not seen during the reception of the lower address byte (A7 to A0) and data bytes. The hardware asserts the ACKTIM bit on the falling edge of the eighth clock and deasserts on the rising edge of the ninth clock. In this case, ACKTIM is not asserted on the upper address byte reception. When AHEN (I2CxCONH<1>) = 1, the clock is stretched after the 8th falling edge and the ACKTIM bit is asserted until the clock is released. If AHEN = 0, the clock is not stretched and ACKTIM is asserted during the Acknowledgment sequence, which is of a very short duration. Therefore, the user application can see this issue of the ACKTIM bit not getting asserted when AHEN = 1.

Work around

Instead of polling for ACKTIM to be asserted, poll for the RBF flag (I2CxSTAT<1>).

Affected Silicon Revisions

A2								
X								

7. Module: MCCP/SCCP (Output Compare)

The Single Edge Compare Event Status (SCEVT) bit (CCPxSTATL<3>) may not set for Single Edge mode, drive output low on match (MOD<3:0> = 0010). In this case, the comparator output is still driven low on the first CCPxRA match, but will not be reset by writing '0' to the SCEVT bit.

All MCCPs/SCCPs are affected.

Work around

This mode may be used to trigger a single event before the module must be reinitialized by clearing and setting CCPON (CCPxCON1L<15>).

The Capture/Compare Interrupt Flag (CCPxIF) still occurs on a match with CCPxRA, and can be used to update the user that a compare event has been triggered and the module needs to be reset.

Affected Silicon Revisions

A2								
X								

8. Module: SPI

The RX watermark interrupt is not asserted for the first few bytes in Sleep mode when the SPI slave is configured for Enhanced Buffer 8, 16 or 32-Bit mode (MSTEN = 0, ENHBUF = 1).

The interrupt does not get asserted for any value of buffer mask (RXMSK<5:0>). For 8-bit mode, interrupt after 32; for 16-bit mode, interrupt after 16; for 32-bit mode, interrupt after 8.

Work around

Tie the SPI clock pin to the external interrupt in the Slave device. This work around has a limitation on SPI speed of 5 MHz.

Affected Silicon Revisions

A2								
X								

PIC24FJ256GA412/GB412 FAMILY

9. Module: SPI

The SPI module, irrespective of master or slave configured for PCM/DSP mode, follows the Right Justified mode of transmission and reception.

Work around

None.

Affected Silicon Revisions

A2								
X								

10. Module: SPI

In Slave Left Justified or Right Justified modes, the Most Significant bit of the data is missed.

Work around

None.

Affected Silicon Revisions

A2								
X								

11. Module: SPI

When the SPI is a slave and is configured for Left Justified or Right Justified mode at start-up, the Idle state of the SDOx pin will be the same as the Most Significant bit (MSb) of the first data packet loaded to the buffer.

For example:

1. If the first data loaded to the buffer is 0xA5A5 (where the MSb is '1'), then at start-up, the Idle state of SDOx will be HIGH.
2. If the first data loaded to the buffer is 5A5A (where the MSb is '0'), then at start-up, the Idle state of SDOx will be LOW.

Work around

None.

Affected Silicon Revisions

A2								
X								

12. Module: SPI

While operating in Master mode (MSTEN = 1), the transmit watermark interrupt is not asserted if there is more than one entry in the FIFO buffer.

This means, for various modes, that the interrupt is not asserted for:

- More than one byte to be transmitted in 8-bit mode;
- More than one word to be transmitted in 16-bit mode; or
- More than one double word to be transmitted in 32-bit mode.

Work around

None.

Affected Silicon Revisions

A2								
X								

PIC24FJ256GA412/GB412 FAMILY

13. Module: Primary XT and HS Oscillator (POSC)

The Primary Oscillator Start-up Timer (OST) may indicate the oscillator is ready for use too early.

Clocking the device before the oscillator is ready may result in incorrect execution and exceptions.

This issue exists when the POSC is requested at power-on, during clock switching, when waking from Sleep or when a peripheral module requests the POSC directly. This issue affects XT and HS modes only.

Work around

Make sure that the Primary Oscillator clock is ready before using it by following these steps:

1. Running on a non-POSC source, request the POSC clock using a peripheral such as REFO.
2. Provide a delay to stabilize POSC.
3. Switch to the POSC source.

[Example 1](#) shows a work around for the device power-on and [Example 2](#) explains the work around when the device wakes from Sleep.

EXAMPLE 1: USING POSC AT POWER-ON

```
#pragma config FNOSC = FRCDIV // Oscillator Selection bits (Fast RC oscillator (FRC))
// Clock Switching Enabled (Fail-safe Clock Monitor can be enabled or disabled)
#pragma config FCKSM = CSECMD
-----
void main()
{
// configure REFO to request POSC
REFOCONLbits.ROSEL = 2; // POSC = 2
REFOCONLbits.ROOUT = 0; // disable output
REFOCONLbits.ROEN = 1; // enable module
// wait for POSC stable clock
// this delay may vary depending on different application conditions
// such as voltage, temperature, layout, XT or HS mode and components
{ // 9 ms delay
unsigned short delay = (unsigned short)(0.009*8000000/2);
asm volatile ("repeat %0 \n nop" : : "r"(delay));
}
// switch to POSC = 2
__builtin_write_OSCCONH(0x02); // 2 = PRIMARY OSC
__builtin_write_OSCCONL(OSCCON | 0x01);
// Wait for Clock switch to occur
while (OSCCONbits.OSWEN==1);
-----
```

PIC24FJ256GA412/GB412 FAMILY

EXAMPLE 2: USING POSC WHEN WAKING FROM SLEEP

```
// Clock Switching Enabled (Failsafe Clock Monitor can be enabled or disabled)
#pragma config FCKSM = CSECMD

-----

__builtin_write_OSCCONH(0x02);           // 2 = PRIMARY OSC
__builtin_write_OSCCONL(OSCCON | 0x01);
// Wait for Clock switch to occur
while (OSCCONbits.OSWEN== 1);
// enter sleep mode
Sleep();
// configure REFO to request POSC
REFOCONLbits.ROSEL = 2;                  // POSC = 2
REFOCONLbits.ROOUT = 0;                  // disable output
REFOCONLbits.ROEN = 1;                   // enable module
// wait for POSC stable clock
// this delay may vary depending on different application conditions
// such as voltage, temperature, layout, XT or HS mode and components
{ // 9 ms delay
unsigned short delay = (unsigned short)(0.009*8000000/2);
asm volatile ("repeat %0 \n nop" : : "r"(delay));
}
// switch to POSC = 2
__builtin_write_OSCCONH(0x02);           // 2 = PRIMARY OSC
__builtin_write_OSCCONL(OSCCON | 0x01);
// Wait for Clock switch to occur
while (OSCCONbits.OSWEN== 1);
-----
```

Affected Silicon Revisions

A2								
X								

PIC24FJ256GA412/GB412 FAMILY

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS30010089D):

<p>Note: Corrections are shown in bold. Where possible, the original bold text formatting has been removed for clarity.</p>

1. Module: Memory Organization

In Table 4-3: UDID Addresses, the UDID3 address has been changed from 801303 to **801304**.

2. Module: Electrical Characteristics

Due to the double-word instruction fetch process, the lowest IDD current is achieved when the BRA/GOTO instruction is aligned on an even address pair; for example, 0x00, 0x04, 0x08 and so on.

CPU should be executing:

```
while(1)
{
    Nop();
    // Nop(); /* add or remove second Nop();
              to shift BRA/GOTO instruction
              alignment */
}
```

PIC24FJ256GA412/GB412 FAMILY

APPENDIX A: DOCUMENT REVISION HISTORY

Rev A Document (7/2015)

Initial release of this document; issued for silicon revision A2.

Rev B Document (6/2016)

Adds silicon issues **8. Module: “SPI”**, **9. Module: “SPI”**, **10. Module: “SPI”**, **11. Module: “SPI”**, **12. Module: “SPI”** and **13. Module: “Primary XT and HS Oscillator (POSC)”**.

Rev C Document (12/2016)

Updates the Device Data Sheet reference to the current revision D (DS30010089D) and adds additional content for PIC24FJ256GA412 family devices.

Adds data sheet clarifications **1. Module: “Memory Organization”** and **2. Module: “Electrical Characteristics”**.

PIC24FJ256GA412/GB412 FAMILY

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC[®] MCUs and dsPIC[®] DSCs, KEELoQ[®] code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

**QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
= ISO/TS 16949 =**

Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BeaconThings, BitCloud, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Heldo, JukeBlox, KEELoQ, KEELoQ logo, Klear, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, RightTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, chipKIT, chipKIT logo, CodeGuard, CryptoAuthentication, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PureSilicon, QMatrix, RightTouch logo, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2015-2016, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-1239-7



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon

Hong Kong
Tel: 852-2943-5100
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing
Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115
Fax: 86-571-8792-8116

China - Hong Kong SAR
Tel: 852-2943-5100
Fax: 852-2401-3431

China - Nanjing
Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-3326-8000
Fax: 86-21-3326-8021

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8864-2200
Fax: 86-755-8203-1760

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

ASIA/PACIFIC

China - Xiamen
Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai
Tel: 86-756-3210040
Fax: 86-756-3210049

India - Bangalore
Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-3019-1500

Japan - Osaka
Tel: 81-6-6152-7160
Fax: 81-6-6152-9310

Japan - Tokyo
Tel: 81-3-6880-3770
Fax: 81-3-6880-3771

Korea - Daegu
Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur
Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang
Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-5778-366
Fax: 886-3-5770-955

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

France - Saint Cloud
Tel: 33-1-30-60-70-00

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-67-3636

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7289-7561

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820