

PIC18F6310/6410/8310/8410 Rev. B3 Silicon Errata

The PIC18F6310/6410/8310/8410 Rev. B3 parts you have received conform functionally to the Device Data Sheet (DS39635C), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F6310/6410/8310/8410 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

All of the issues listed here will be addressed in future revisions of the PIC18F6310/6410/8310/8410 silicon.

The following silicon errata apply only to PIC18F6310/6410/8310/8410 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F6310	0000 1011 111	0 0011
PIC18F6410	0000 0110 111	0 0011
PIC18F8310	0000 1011 110	0 0011
PIC18F8410	0000 0110 110	0 0011

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFFh in the device's configuration space. They are shown in hexadecimal in the format "DEVID2 DEVID1".

1. Module: MSSP

In its current implementation, the I²C™ Master mode operates as follows:

- a) The Baud Rate Generator for I²C in Master mode is slower than the rates specified in Table 16-3 of the Device Data Sheet.

For this revision of silicon, use the values shown in Table 1 in place of those shown in Table 16-3 of the Device Data Sheet. The differences are shown in **bold text**.

- b) Use the following formula in place of the one shown in Register 16-4 (SSPCON1) of the Device Data Sheet for bit description SSPM3:SSPM0 = 1000.

$$SSPADD = \text{INT}((F_{CY}/F_{SCL}) - (F_{CY}/1.111 \text{ MHz})) - 1$$

Date Codes that pertain to this issue:

All engineering and production devices.

TABLE 1: I²C™ CLOCK RATE w/BRG

Fosc	Fcy	Fcy * 2	BRG Value	Fscl (2 Rollovers of BRG)
40 MHz	10 MHz	20 MHz	0Eh	400 kHz ⁽¹⁾
40 MHz	10 MHz	20 MHz	15h	312.5 kHz
40 MHz	10 MHz	20 MHz	59h	100 kHz
16 MHz	4 MHz	8 MHz	05h	400 kHz ⁽¹⁾
16 MHz	4 MHz	8 MHz	08h	308 kHz
16 MHz	4 MHz	8 MHz	23h	100 kHz
4 MHz	1 MHz	2 MHz	01h	333 kHz ⁽¹⁾
4 MHz	1 MHz	2 MHz	08h	100 kHz
4 MHz	1 MHz	2 MHz	00h	1 MHz ⁽¹⁾

Note 1: The I²C™ interface does not conform to the 400 kHz I²C specification (which applies to rates greater than 100 kHz) in all details, but may be used with care where higher rates are required by the application.

PIC18F6310/6410/8310/8410

2. Module: MSSP

When the MSSP is configured for SPI Master mode, the SDO pin cannot be disabled by setting the TRISC<5> bit. The SDO pin always outputs the content of SSPBUF regardless of the state of the TRIS bit.

In Slave mode with Slave Select enabled, SSPM3:SSPM0 = 0010 (SSPCON1<3:0>), the SDO pin can be disabled by placing a logic high level on the \overline{SS} pin (RF7).

Work around

None.

Date Codes that pertain to this issue:

All engineering and production devices.

3. Module: MSSP

After an I²C transfer is initiated, the SSPBUF register may be written for up to 10 T_{CY} before additional writes are blocked. The data transfer may be corrupted if SSPBUF is written during this time.

The WCOL bit is set any time an SSPBUF write occurs during a transfer.

Work around

Avoid writing SSPBUF until the data transfer is complete, indicated by the setting of the SSPIF bit (PIR1<3>).

Verify the WCOL bit (SSPCON1<7>) is clear after writing SSPBUF to ensure any potential transfer in progress is not corrupted.

Date Codes that pertain to this issue:

All engineering and production devices.

4. Module: MSSP

In 10-bit Addressing mode, when a Repeated Start is issued followed by the high address byte and a Write (R/W = 0), an ACK is not issued.

Work around

There are two work arounds available:

1. Single-Master Environment:
In a single-master environment, the user must issue a Stop, then a Start, followed by a write to the address high, then the address low followed by the data.
2. Multi-Master Environment:
In a multi-master environment, the user must issue a Repeated Start, send a Dummy Write to a different address, issue another Repeated Start and then send a write to the original address. This procedure will help maintain control of the bus.

Date Codes that pertain to this issue:

All engineering and production devices.

5. Module: MSSP

I²C Receive mode should be enabled (i.e., RCEN bit should be set) only when the system is idle (i.e., when ACKEN, RCEN, PEN, RSEN and SEN all equal zero). It should not be possible to set the RCEN bit when the system is not idle, however, the RCEN bit can be set under this circumstance.

Work around

Wait for the system to become idle before setting the RCEN bit. This requires a check for the following bits to be clear:

ACKEN, RCEN, PEN, RSEN and SEN.

Date Codes that pertain to this issue:

All engineering and production devices.

6. Module: CCP

When operating either Timer1 or Timer3 as a counter with a prescale value other than 1:1 and operating the CCP in Compare mode with the Special Event Trigger (CCP1CON bits CCP1M3:CCP1M0 = 1011), the Special Event Trigger Reset of the timer occurs as soon as there is a match between TMRxH:TMRxL and CCPR1H:CCPR1L.

This differs from the PIC18F452, where the Special Event Trigger Reset of the timer occurs on the next prescaler output pulse after the match between TMRxH:TMRxL and CCPR1H:CCPR1L.

Work around

To achieve the same timer Reset period on the PIC18F8410 family as the PIC18F452 family for a given clock source, add 1 to the value in CCPR1H:CCPR1L. In other words, if CCPR1H:CCPR1L = x for the PIC18F452, to achieve the same Reset period on the PIC18F8410 family, CCPR1H:CCPR1L = x + 1, where the prescale is 1, 2, 4 or 8 depending on the T1CKPS1:T1CKPS0 bit values.

Date Codes that pertain to this issue:

All engineering and production devices.

7. Module: CCP

The CCP1 and CCP2 configured for PWM mode, with 1:1 Timer2 prescaler and duty cycle set to the period minus 1, may result in the PWM output(s) remaining at a logic low level.

Clearing the PR2 register to select the fastest period may also result in the output(s) remaining at a logic low output level.

Work around

To ensure a reliable waveform, verify that the selected duty cycle does not equal the 10-bit period minus 1 prior to writing these locations, or use 1:4 or 1:16 Timer2 prescale. Also, verify the PR2 register is not written to 00h.

All other duty cycle and period settings will function as described in the Device Data Sheet.

The CCP modules remain capable of 10-bit accuracy.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6310/6410/8310/8410

8. Module: A/D

The A/D offset is greater than the specified limit in Table 26-25 of the Device Data Sheet. The additional Parameter A06A and updated conditions and limits are shown in **bold** text in Table 2.

Work around

Three work arounds exist.

1. Configure the A/D to use the VREF+ and VREF- pins for the voltage references. This is done by setting the VCFG<1:0> bits (ADCON1<5:4>).

2. Perform a conversion on a known voltage reference voltage and adjust the A/D result in software.
3. Increase system clock speed to 40 MHz and adjust A/D settings accordingly. Higher system clock frequencies decrease offset error.

Date Codes that pertain to this issue:

All engineering and production devices.

**TABLE 2: A/D CONVERTER CHARACTERISTICS: PIC18F6310/6410/8310/8410 (INDUSTRIAL)
PIC18LF6310/6410/8310/8410 (INDUSTRIAL)**

Param No.	Symbol	Characteristic	Min.	Typ.	Max.	Units	Conditions
A06A	E0FF	Offset Error	—	—	<±1.5	LSb	VREF = VREF+ and VREF-
A06	E0FF	Offset Error	—	—	<±3.5	LSb	VREF = VSS and VDD

9. Module: BOD

The BOD module may reset below the minimum operating voltage of the device when configured for BORV1:BORV0 = 11. The updated Reset voltage specifications are shown in **bold** in Table 3.

TABLE 3: BROWN-OUT RESET VOLTAGE

Param No.	Sym.	Characteristic	Min.	Typ.	Max.	Unit
D005	VBOR	Brown-out Reset Voltage				
		PIC18LF6310/6410/8310/8410				
		BORV1:BORV0 = 11	N/A	2.05	N/A	V

Work around

Use the next higher BOD voltage setting to ensure a low VDD is detected above 2.0V.

Date Codes that pertain to this issue:

All engineering and production devices.

10. Module: EUSART

When performing back-to-back transmission in 9-bit mode (TX9D bit in the TXSTAx register is set), an ongoing transmission's timing can be corrupted if the TX9D bit (for the next transmission) is not written immediately following the setting of TXxIF. This is because any write to the TXSTAx register results in a reset of the Baud Rate Generator which will effect any ongoing transmission.

Work around

Load TX9D just after TXxIF is set, either by polling TXxIF or by writing TX9D at the beginning of the Interrupt Service Routine, or only write to TX9D when a transmission is not in progress (TRMT = 1).

Date Codes that pertain to this issue:

All engineering and production devices.

11. Module: EUSART

When performing back-to-back transmission in 9-bit mode (TX9D bit in the TXSTAx register is set), the second byte may be corrupted if it is written into TXREGx immediately after the TMRT bit is set.

Work around

Execute a software delay, at least one-half the transmission's bit time, after TMRT is set and prior to writing subsequent bytes into TXREGx.

Date Codes that pertain to this issue:

All engineering and production devices.

12. Module: AUSART

The AUSART for PIC18F6310/6410/8310/8410 devices may not recognize a received Stop bit if the combined error rate is too high.

Work around

1. Increase the baud rate of the device by decrementing the SPBRGHx:SPBRGx register pair value by one. Verify that the new baud rate does not exceed the maximum combined error rate of the application.
2. Configure the transmitter to send two Stop bits.

Date Codes that pertain to this issue:

All engineering and production devices.

13. Module: Timer1/Timer3

When Timer1 or Timer3 is configured for external clock source and the CCPxCON register is configured with 0x0B (Compare mode, trigger special event), the timer is not reset on a Special Event Trigger.

Work around

Modify firmware to reset the Timer1/Timer3 registers upon detection of the compare match condition — TMRxL and TMRxH.

Date Codes that pertain to this issue:

All engineering and production devices.

14. Module: Timer1/Timer3

When Timer1 or Timer3 is in External Clock Synchronized mode and the external clock period is between 1 and 2 T_{cy}, interrupts will occasionally be skipped.

Work around

Avoid using an external clock with a period (1/frequency) between 1 and 2 T_{cy}.

Date Codes that pertain to this issue:

All engineering and production devices.

15. Module: Timer1/Timer3

When Timer1/Timer3 is operating in 16-bit mode and the prescale setting is not 1:1, a write to the TMR1H/TMR3H Buffer registers may lengthen the duration of the period between the increments of the timer for the period in which TMR1H/TMR3H was written.

Work around

Two work arounds are available: 1) Stop Timer1/Timer3 before writing the TMR1H/TMR3H registers; 2) Write TMR1L/TMR3L immediately after writing TMR1H/TMR3H.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6310/6410/8310/8410

16. Module: Interrupts

If an interrupt occurs during a 2-cycle instruction that modifies the STATUS, BSR or WREG register, the unmodified value of the register will be saved to the corresponding Fast Return (Shadow) register and upon a fast return from the interrupt, the unmodified value will be restored to the STATUS, BSR or WREG register.

For example, if a high priority interrupt occurs during the instruction, `MOVFF TEMP, WREG`, the `MOVFF` instruction will be completed and WREG will be loaded with the value of TEMP before branching to ISR. However, the previous value of WREG will be saved to the Fast Return register during ISR branching. Upon return from the interrupt with a fast return, the previous value of WREG in the Fast Return register will be written to WREG. This results in WREG containing the value it had before execution of `MOVFF TEMP, WREG`.

Affected instructions are:

```
MOVFF Fs, Fd
```

where Fd is WREG, BSR or STATUS;

```
MOVSF Zs, Fd
```

where Fd is WREG, BSR or STATUS; and

```
MOVSS [Zs], [Zd]
```

where the destination is WREG, BSR or STATUS.

Work around

1. Assembly Language Programming:
 - a) If any 2-cycle instruction is used to modify the WREG, BSR or STATUS register, do not use the `RETFIE FAST` instruction to return from the interrupt. Instead, save/restore WREG, BSR and STATUS via software per Example 9-1 in the Device Data Sheet. Alternatively, in the case of `MOVFF`, use the `MOVF` instruction to write to WREG instead. For example, use:

```
MOVF    TEMP, W
MOVWF   BSR
```

instead of: `MOVFF TEMP, BSR`.
 - b) As another alternative, the following work around shown in [Example 1](#) can be used. This example overwrites the Fast Return register by making a dummy call to `Foo` with the fast option in the high priority service routine.

EXAMPLE 1: DUMMY CALL ROUTINE

```
ISR @ 0x0008
  CALL Foo, FAST; store current value of WREG, BSR, STATUS for a second time
Foo:
  POP          ; clears return address of Foo call
  :           ; insert high priority ISR code here
  :
  RETFIEFAST
```

PIC18F6310/6410/8310/8410

2. C Language Programming: The exact work around depends on the compiler in use. Please refer to your C compiler documentation for details.

If using the Microchip MPLAB® C18 C Compiler, define both high and low priority interrupt handler functions as “low priority” by using the `pragma interruptlow` directive. This directive instructs the compiler to not use the `RETFIE FAST` instruction. If the proper high priority interrupt bit is set in the IPRx reg-

ister, then the interrupt is treated as high priority in spite of the `pragma interruptlow` directive.

The code segment shown in [Example 2](#) demonstrates the work around using the C18 compiler. An optimized C18 version is also provided in [Example 3](#). This example illustrates how it reduces the instruction cycle count from 10 cycles to 3.

Date Codes that pertain to this issue:

All engineering and production devices.

EXAMPLE 2: C18 COMPILER EXAMPLE

```
#pragma interruptlow MyLowISR
void MyLowISR(void)
{
    // Handle low priority interrupts.
}

// Although MyHighISR is a high priority interrupt, use interruptlow pragma so that
// the compiler will not use retfie FAST.

#pragma interruptlow MyHighISR
void MyHighISR(void)
{
    // Handle high priority interrupts.
}

#pragma code highVector=0x08
void HighVector (void)
{
    _asm goto MyHighISR _endasm
}
#pragma code /* return to default code section */

#pragma code lowVector=0x18
```

EXAMPLE 3: OPTIMIZED C18 COMPILER EXAMPLE

```
#pragma code high_vector_section=0x8
void high_vector (void)
{
    _asm
        CALL high_vector_branch, 1
    _endasm
}

void high_vector_branch (void)
{
    _asm
        POP
        GOTO high_isr
    _endasm
}

#pragma interrupt high_isr
```

PIC18F6310/6410/8310/8410

17. Module: External Memory Bus (EMB)

When the EMB is enabled and configured for 8-bit mode and EBDIS (MEMCON<7>) is clear, the BA0 pin continues to be active during table read and table write operations to internal program memory addresses. Under these conditions, BA0 should be inactive.

Work around

Set the EBDIS bit when performing table operations to internal program memory.

Date Codes that pertain to this issue:

All engineering and production devices.

18. Module: EUSART

The EUSART auto-baud feature may periodically measure the incoming baud rate incorrectly. The rate of incorrect baud rate measurements will depend on the frequency of the incoming synchronization byte and the system clock frequency.

Work around

None.

Date Codes that pertain to this issue:

All engineering and production devices.

19. Module: EUSART

In Synchronous mode (SYNC = 1) with clock polarity high (SCKP = 1), the EUSART transmits a shorter than expected clock on the CKx pin for bit 0.

Work around

None.

Date Codes that pertain to this issue:

All engineering and production devices.

20. Module: EUSART

In Synchronous mode, EUSART baud rates using SPBRGx values of '0' and '1' may not function correctly.

Work around

Use another baud rate configuration to generate the desired baud rate.

Date Codes that pertain to this issue:

All engineering and production devices.

21. Module: MSSP

In an I²C™ system with multiple slave nodes, an unaddressed slave may respond to bus activity when data on the bus matches its address. The first occurrence will set the BF bit. The second occurrence will set the BF and SSPOV bits. In both situations, the SSPIF bit is not set and an interrupt will not occur. The device will vector to the Interrupt Service Routine only if the interrupt is enabled and an address match occurs.

Work around

The I²C slave must clear the SSPOV bit after each I²C address match to maintain normal operation.

Date Codes that pertain to this issue:

All engineering and production devices.

22. Module: MSSP

In I²C Master mode, the BRG value of '0' may not work correctly.

Work around

Use a BRG value greater than '0' by setting SSPADD ≥ 1.

Date Codes that pertain to this issue:

All engineering and production devices.

23. Module: MSSP

In I²C Master mode, the RCEN bit is set by software to begin data reception and cleared by the peripheral after a byte is received. After a byte is received, the device may take up to 80 T_{CY} to clear RCEN and 800 T_{CY} when using MPLAB® ICD 2 and MPLAB ICE emulators.

Work around

Single byte receptions are typically not affected, since the delay between byte receptions is typically long enough for the RCEN bit to clear. For multiple byte receptions, the software must wait until the bit is cleared by the peripheral before the next byte can be received.

Date Codes that pertain to this issue:

All engineering and production devices.

24. Module: MSSP

Setting the SEN bit initiates a Start sequence on the bus, after which, the SEN bit is cleared automatically by hardware. If the SEN bit is set again (without an address byte being transmitted), a Start sequence will not commence and the SEN bit will not be cleared. This condition causes the bus to remain in an active state. The system is Idle when ACKEN, RCEN, PEN, RSEN and SEN are clear.

Work around

Set the PEN or RSEN bit to transmit a Stop or Repeated Start sequence, although the SEN bit may still be set, indicating the bus is active. After the sequence has completed, the PEN, RSEN and SEN bit will be clear, indicating the bus is Idle. Clearing and setting the SSPEN bit will also reset the I²C peripheral and clear the PEN, RSEN and SEN status bits.

Date Codes that pertain to this issue:

All engineering and production devices.

25. Module: MSSP

In SPI mode, the Buffer Full flag (BF bit in the SSPSTAT register), the Write Collision Detect bit (WCOL bit in SSPCON1) and the Receive Overflow Indicator bit (SSPOV in SSPCON1) are not reset upon disabling the SPI module (by clearing the SSPEN bit in the SSPCON1 register).

For example, if SSPBUF is full (BF bit is set) and the MSSP module is disabled and re-enabled, the BF bit will remain set. In SPI Slave mode, a subsequent write to SSPBUF will result in a write collision. Also, if a new byte is received, a receive overflow will occur.

Work around

Ensure that if the buffer is full, SSPBUF is read (thus clearing the BF flag) and WCOL is clear before disabling the MSSP module. If the module is configured in SPI Slave mode, ensure that the SSPOV bit is clear before disabling the module.


Date Codes that pertain to this issue:

All engineering and production devices.

26. Module: MSSP (SPI Mode)

When the SPI is using Timer2/2 as the clock source, a shorter than expected SCK pulse may occur on the first bit of the transmitted/received data (Figure 1).

FIGURE 1: SCK PULSE VARIATION USING TIMER2/2

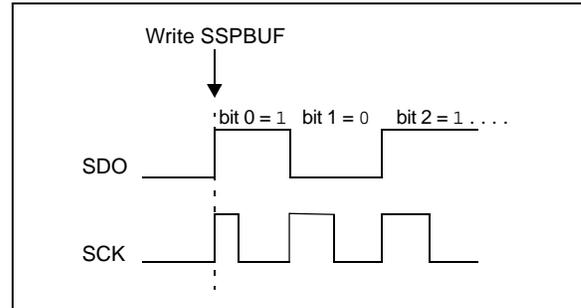

Work around

To avoid producing the short pulse, turn off Timer2 and clear the TMR2 register, load the SSPBUF with the data to transmit and then turn Timer2 back on. Refer to Example 4 for sample code.

EXAMPLE 4: AVOIDING THE INITIAL SHORT SCK PULSE

```

LOOPBTFS SSPSTAT, BF;Data received?
                ;(Xmit complete?)
BRA LOOP      ;No
MOVW SSPBUF, W ;W = SSPBUF
MOVW FRXDATA, W ;Save in user RAM
MOVW TXDATA, W ;W = TXDATA
BCF T2CON, TMR2ON;Timer2 off
CLRFTMR2      ;Clear Timer2
MOVW SSPBUF, W ;Xmit New data
BSF T2CON, TMR2ON;Timer2 on
    
```

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6310/6410/8310/8410

27. Module: Timer1 (Asynchronous Counter)

When writing to the TMR1H register, under specific conditions, it is possible that the TMR1L register will miss a count while connected to the external oscillator via the T1OSO and T1OSI pins.

When Timer1 is started, the circuitry looks for a falling edge before a rising edge can increment the counter. Writing to the TMR1H register is similar to starting Timer1; therefore, the former logic stated applies any time the TMR1H register is written. If the TMR1H register is not completely written to during the high pulse of the external clock, then the TMR1L register will miss a count due to the circuit operation stated previously. The high pulse of a 32.768 kHz external clock crystal yields a 15.25 μ s window for the write to TMR1H

to occur. The amount of instructions that can be executed within this window is frequency dependent, as shown in [Table 4](#) below.

Work around

Operating Conditions: $F_{osc} \geq 4$ MHz, no wake-ups from Sleep, Timer1 interrupt enabled, global interrupts enabled.

The code excerpts in [Example 5](#) and [Example 6](#) show how the TMR1H register can be updated while the external clock (32.768 kHz) is still on its high pulse.

The importance of the code examples is that the **bold** instructions are executed within the first 15.25 μ s high pulse on the external clock after the Timer1 overflow occurs. This will allow the TMR1L register to increment correctly.

TABLE 4: FREQUENCY DEPENDENT INSTRUCTION EXECUTION AMOUNTS

Fosc	Tcy (μ s)	Tcy within 15.25 μ s
1 MHz	4	3.81
2 MHz	2	7.63
4 MHz	1	15.25
8 MHz	0.5	30.5
16 MHz	0.25	61
20 MHz	0.2	76.25
40 MHz	0.1	152.5

EXAMPLE 5: PIC18 HIGH PRIORITY INTERRUPT SERVICE ROUTINE

```
ISR @ 0x0008 ; (3-4Tcy), fixed interrupt latency

    BRA    HIGHINT ; (2Tcy), go to high priority interrupt routine

HIGHINT
    BTFSC PIR1, TMR1IF ; (1Tcy), did a Timer1 overflow occur?
    BSF    TMR1H, 7 ; (1Tcy) Yes, reload for a 1 second overflow
```

EXAMPLE 6: PIC18 LOW PRIORITY INTERRUPT SERVICE ROUTINE

```
ISR @ 0x0018 ; (3-4Tcy), fixed interrupt latency

    MOVFF STATUS, STATUS_TEMP ; (2Tcy), save STATUS register
    MOVFF WREG, WREG_TEMP ; (2Tcy), save working register, refer to note 1
    MOVFF BSR, BSR_TEMP ; (2Tcy), save BSR register, refer to note 1

    BTFSS PIR1, TMR1IF ; (2Tcy), did a Timer1 overflow occur?
    BRA    EXIT ; No
    BSF    TMR1H, 7 ; (1Tcy) Yes, reload for a 1 second overflow

EXIT
    MOVFF BSR_TEMP, BSR ;restore BSR register, refer to note 1
    MOVFF WREG_TEMP, WREG ;restore working register, refer to note 1
```

Note: These instructions are required based on the function of the ISR. If the only code in the ISR is to reload Timer1, then they are not required, but may be required if additional code is added.

Date Codes that pertain to this issue:

All engineering and production devices.

28. Module: EUSART

In rare situations, one or more extra zero bytes have been observed in a packet transmitted by the module operating in Asynchronous mode. The actual data is not lost or corrupted; only unwanted (extra) zero bytes are observed in the packet.

This situation has only been observed when the contents of the transmit buffer, TXREG, are transferred to the TSR during the transmission of a Stop bit. For this to occur, three things must happen in the same instruction cycle:

- TXREG is written to;
- the baud rate counter overflows (at the end of the bit period); and
- a Stop bit is being transmitted (shifted out of TSR).

Work around

If possible, do not use the module's double buffer capability. Instead, load the TXREG register when the TRMT bit (TXSTA<1>) is set, indicating the TSR is empty.

If double-buffering is used and back-to-back transmission is performed, then load TXREG immediately after TXIF is set or wait 1-bit time after TXIF is set. Both solutions prevent writing TXREG while a Stop bit is transmitted. Note that TXIF is set at the beginning of the Stop bit transmission.

If transmission is intermittent, then do the following:

- Wait for the TRMT bit to be set before loading TXREG
- Alternatively, use a free timer resource to time the baud period. Set up the timer to overflow at the end of Stop bit, then start the timer when you load the TXREG. Do not load the TXREG when timer is about to overflow.

Date Codes that pertain to this issue:

All engineering and production devices.

29. Module: EUSART/AUSART

In 9-Bit Asynchronous Full-Duplex Receive mode, the received data may be corrupted if the TX9D bit (TXSTA<0>) is not modified immediately after the RCIDL bit (BAUDCON<6>) is set.

Work around

Write to TX9D only when a reception is not in progress (RCIDL = 1). Since there is no interrupt associated with RCIDL, it must be polled in software to determine when TX9D can be updated.

Date Codes that pertain to this issue:

All engineering and production devices.

30. Module: EUSART

After the last received byte has been read from the EUSART receive buffer, RCREG, the value is no longer valid for subsequent read operations.

Work around

The RCREG register should only be read once for each byte received. After each byte is received from the EUSART, store the byte into a user variable. To determine when a byte is available to read from RCREG, poll the RCIDL bit (BAUDCON<6>) for a low-to-high transition, or use the EUSART receive interrupt, RCIF (PIR1<5>).

Date Codes that pertain to this issue:

All engineering and production devices.

31. Module: EUSART

With the auto-wake-up option enabled by setting the WUE (BAUDCON<1>) bit, the RCIF (PIR1<5>) bit will become set on a high-to-low transition on the RX pin. While the WUE bit is set, reading the receive buffer, RCREG, will not clear the RCIF interrupt flag. Therefore, the first opportunity to automatically clear RCIF by reading RCREG will happen only after WUE bit is cleared.

Note: RCIF can only be cleared by reading RCREG.

Work around

1. Poll the WUE bit and read RCREG after the WUE bit is automatically cleared.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6310/6410/8310/8410

32. Module: Timer1

In 16-Bit Asynchronous Counter mode (with or without use of the Timer1 oscillator), the TMR1H and TMR3H buffers do not update when TMRxL is read.

This issue only affects reading the TMRxH registers. The timers increment and set the interrupt flags as expected. The timer registers can also be written as expected.

Work around

1. Use 8-bit mode by clearing the RD16 bit (T1CON<7>).
2. Use the internal clock synchronization option by clearing the T1SYNC bit (T1CON<2>).

Date Codes that pertain to this issue:

All engineering and production devices.

33. Module: Timer1/3

When Timer1 or Timer3 is operated in Asynchronous External Input mode, unexpected interrupt flag generation may occur if an external clock edge arrives too soon following a firmware write to the TMRxH:TMRxL registers. An unexpected interrupt flag event may also occur when enabling the module or switching from Synchronous to Asynchronous mode.

Work around

This issue only applies when operating the timer in Asynchronous mode. Whenever possible, operate the timer module in Synchronous mode to avoid spurious timer interrupts.

If Asynchronous mode must be used in the application, potential strategies to mitigate the issue may include any of the following:

- Design the firmware so it does not rely on the TMRxIF flag or keep the respective interrupt disabled. The timer still counts normally and does not reset to 0x0000 when the spurious interrupt flag event is generated.
- Design the firmware so that it does not write to the TMRxH:TMRxL registers or does not periodically disable/enable the timer, or switch modes. Reading from the timer does not trigger the spurious interrupt flag events.
- If the firmware must use the timer interrupts and must write to the timer (or disable/enable, or mode switch the timer), implement code to suppress the spurious interrupt event, should it occur. This can be achieved by following the process shown in [Example 7](#).

EXAMPLE 7: ASYNCHRONOUS TIMER MODE WORK AROUND TO AVOID SPURIOUS INTERRUPT

```
//Timer1 update procedure in asynchronous mode
//The code below uses Timer1 as example

T1CONbits.TMR1ON = 0;           //Stop timer from incrementing
PIE1bits.TMR1IE = 0;           //Temporarily disable Timer1 interrupt vectoring
TMR1H = 0x00;                   //Update timer value
TMR1L = 0x00;
T1CONbits.TMR1ON = 1;           //Turn on timer

//Now wait at least two full T1CKI periods + 2TCY before re-enabling Timer1 interrupts.
//Depending upon clock edge timing relative to TMR1H/TMR1L firmware write operation,
//a spurious TMR1IF flag event may sometimes assert. If this happens, to suppress
//the actual interrupt vectoring, the TMR1IE bit should be kept clear until
//after the "window of opportunity" (for the spurious interrupt flag event has passed).
//After the window is passed, no further spurious interrupts occur, at least
//until the next timer write (or mode switch/enable event).

while(TMR1L < 0x02);           //Wait for 2 timer increments more than the Updated Timer
                                //value (indicating more than 2 full T1CKI clock periods elapsed)
NOP();                          //Wait two more instruction cycles
NOP();
PIR1bits.TMR1IF = 0;           //Clear TMR1IF flag, in case it was spuriously set
PIE1bits.TMR1IE = 1;           //Now re-enable interrupt vectoring for timer 1
```

34. Module: MSSP

The MSSP configured in SPI slave mode will generate a write collision if SSPBUF is updated and the previous SSPBUF contents have not been transferred to the shift register.

Reinitializing the MSSP by clearing and setting the SSPEN (SSPCON1<5>) bit prior to rewriting SSPBUF will not prevent the error condition.

Work around

Prior to updating the SSPBUF register with a new value, verify whether the previous contents were transferred by reading the BF (SSPSTAT<0>) bit. If the previous byte has not been transferred, update SSPBUF and clear the WCOL (SSPCON1<7>) bit if necessary.

Date Codes that pertain to this issue:

All engineering and production devices.

35. Module: MSSP

In SPI mode, the SDO output may change after the inactive clock edge of the bit '0' output. This may affect some SPI components that read data over 300 ns after the inactive edge of SCK.

Work around

None

Date Codes that pertain to this issue:

All engineering and production devices.

36. Module: MSSP

It has been observed that, following a Power-on Reset, I²C mode may not initialize properly by just configuring the SCL and SDA pins as either inputs or outputs. This has only been seen in a few unique system environments.

A test of a statistically significant sample of pre-production systems, across the voltage and current range of the application's power supply, should indicate if a system is susceptible to this issue.

Work around

Before configuring the module for I²C operation:

1. Configure the SCL and SDA pins as outputs by clearing their corresponding TRIS bits.
2. Force SCL and SDA low by clearing the corresponding LAT bits.
3. While keeping the LAT bits clear, configure SCL and SDA as inputs by setting their TRIS bits.

Once this is done, use the SSPCON1 and SSPCON2 registers to configure the proper I²C mode as before.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6310/6410/8310/8410

37. Module: Reset

This version of silicon does not support the functionality described in Note 1 of parameter D002 in **Section 26.1 “DC Characteristics: Supply Voltage”** of the data sheet. The RAM content may be altered during a Reset event if following conditions are met.

- Device is accessing RAM.
- Asynchronous Reset (i.e., WDT, BOR or $\overline{\text{MCLR}}$ occurs when a write operation is being executed (start of a Q4 cycle).

Work around

None

Date Codes that pertain to this issue:

All engineering and production devices.

38. Module: External Memory Bus

For PIC18F8XXX devices, the Stack Pointer may incorrectly increment during a table read operation if the external memory bus wait states are enabled (i.e., Configuration bit, WAIT, is clear (CONFIG3L<7> = 0) and WAIT bits (MEMCON<5:4>) are not equal to '11').

Work around

If using the external memory bus and performing TBLRD operations with a non-zero wait state (CONFIG3L<7> = 0 and WAIT<1:0> (MEMCON<5:4>) are not equal to '11'), disable interrupts by clearing the GIE/GIEH (INTCON<7>) and PEIE/GIEL (INTCON<6>) bits prior to executing any TBLRD operation.

Date Codes that pertain to this issue:

All engineering and production devices.

39. Module: External Memory Bus

The A19:A16 address lines may release to their inactive states at the same time as Read/Write bus control pins ($\overline{\text{OE}}$, $\overline{\text{WRH}}$ and $\overline{\text{WRL}}$). This violates bus timing condition described in Figure 26.5 and Figure 26.6 of the data sheet. The result may be a device on the memory bus detecting an address change when a Read or Write is initiated.

This situation may be more likely to affect faster peripheral memory devices (e.g., Flash RAMs). Longer propagation delays on the control signal lines, which can be influenced by stray capacitance and other factors, are more likely to adversely affect the situation.

Work around

Two work arounds are presented here. Others may be available.

1. Use a hardware latch, triggered by falling edges on the ALE signal, on the A19:A16 address lines. This will hold the address until $\overline{\text{WRL}}$ or $\overline{\text{WRH}}$ can transition to an inactive state.
2. Add a delay circuit on the A19:A16 address lines to extend the valid time for the signals.

Date Codes that pertain to this issue:

All engineering and production devices.

40. Module: Power-up Timer

If Brown-out Reset (BOR) is disabled, then the Power-up Timer (PWRT) gets disabled irrespective of the state of the PWRTEN Configuration bit (CONFIG2L<0>).

Work around

Do either of the following:

1. Enable the BOR using any desired mode and set point.
2. If BOR operation is not desired:
 - a) Configure the BOR using BOREN<1:0> = 01 (CONFIG2L<2:1>). BOR is controlled by SBOREN.
 - b) Configure the BOR for the lowest voltage set point by clearing the BORV<1:0> bits (CONFIG2L<4:3>).
In this configuration, the SBOREN bit resets to '1', enabling the BOR.
 - c) When code execution begins following all Resets, disable the BOR by clearing the SBOREN bit (RCON<6>).

Date Codes that pertain to this issue:

All engineering and production devices.

41. Module: Analog-to-Digital (A/D) Converter Module

When the A/D clock source is selected as 2 TOSC or RC (when ADCS2:ADCS0 = 000 or x11), in extremely rare cases, the EIL (Integral Linearity Error) and EDL (Differential Linearity Error) may exceed the data sheet specification at codes 511 and 512 only.

Work around

Select a different A/D clock source (4 TOSC, 8 TOSC, 16 TOSC, 32 TOSC or 64 TOSC) and avoid selecting the 2 TOSC or RC modes.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6310/6410/8310/8410

APPENDIX A: REVISION HISTORY

Rev A Document (8/2004)

First revision of this document which includes silicon issues 1-4 (MSSP), 5 (PWM), 6 (CCP), 7 (A/D), 8 (AUSART), 9 (External Memory Bus), 10 (Timer1/Timer3) and 11 (Timer1).

Rev B Document (02/2005)

Updated issues 1, 3, 4, 5 (MSSP), 12 (AUSART) and 14 (Timer1/Timer3) and added issues 6 (CCP), 9 (BOD), 10-11 (EUSART), 15 (Timer1/Timer3) and 16 (Interrupts).

Rev C Document (12/2005)

Updated issues 4 (MSSP) and 16 (Interrupts). Added issues 18-20 (EUSART), 21-25 (MSSP), 26 (MSSP – SPI Mode) and 27 (Timer1 – Asynchronous Counter).

Rev D Document (5/2006)

Updated issue 16 (Interrupts) with optimized C code example. Added issues 28-31 (EUSART), 32 (Timer1), 33-35 (MSSP), 36 (Reset), 37 (External Memory Bus) and 38 (External Memory Bus).

Rev E Document (2/2007)

Added issue 39 (Power-up Timer). Added date code applicability note to issues 18-20 (EUSART), 21-25 (MSSP), 26 (MSSP – SPI Mode), 27 (Timer1 – Asynchronous Counter) and 37-38 (External Memory Bus).

Rev F Document (7/2007)

Added issue 40 (A/D Converter Module).

Rev G Document (01/2015)

Added issue 33 (Timer1/3).

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, FlashFlex, flexPWR, JukeBlox, KEELOQ, KEELOQ logo, Klear, LANCheck, MediaLB, MOST, MOST logo, MPLAB, OptoLyzer, PIC, PICSTART, PIC³² logo, RightTouch, SpyNIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

The Embedded Control Solutions Company and mTouch are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, ECAN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, KlearNet, KlearNet logo, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, RightTouch logo, REAL ICE, SQI, Serial Quad I/O, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademarks of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2004-2015, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-63276-949-7

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949 ==

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC[®] MCUs and dsPIC[®] DSCs, KEELOQ[®] code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland
Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110

Canada - Toronto
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2943-5100
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing
Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Hangzhou
Tel: 86-571-8792-8115
Fax: 86-571-8792-8116

China - Hong Kong SAR
Tel: 852-2943-5100
Fax: 852-2401-3431

China - Nanjing
Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8864-2200
Fax: 86-755-8203-1760

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

China - Xiamen
Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai
Tel: 86-756-3210040
Fax: 86-756-3210049

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-3019-1500

Japan - Osaka
Tel: 81-6-6152-7160
Fax: 81-6-6152-9310

Japan - Tokyo
Tel: 81-3-6880-3770
Fax: 81-3-6880-3771

Korea - Daegu
Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur
Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang
Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-5778-366
Fax: 886-3-5770-955

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Dusseldorf
Tel: 49-2129-3766400

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Pforzheim
Tel: 49-7231-424750

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Venice
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Poland - Warsaw
Tel: 48-22-3325737

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820

03/25/14